

Датчики влажности и температуры FG 80/TFG 80

Технические характеристики

По вопросам продаж и поддержки обращайтесь:

Алматы (727)345-47-04
Ангарск (3955)60-70-56
Архангельск (8182)63-90-72
Астрахань (8512)99-46-04
Барнаул (3852)73-04-60
Белгород (4722)40-23-64
Благовещенск (4162)22-76-07
Брянск (4832)59-03-52
Владивосток (423)249-28-31
Владикавказ (8672)28-90-48
Владимир (4922)49-43-18
Волгоград (844)278-03-48
Вологда (8172)26-41-59
Воронеж (473)204-51-73
Екатеринбург (343)384-55-89

Иваново (4932)77-34-06
Ижевск (3412)26-03-58
Иркутск (395)279-98-46
Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Коломна (4966)23-41-49
Кострома (4942)77-07-48
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Курган (3522)50-90-47
Липецк (4742)52-20-81

Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Нижний Новгород (831)429-08-12
Новокузнецк (3843)20-46-81
Ноябрьск (3496)41-32-12
Новосибирск (383)227-86-73
Омск (3812)21-46-40
Орел (4862)44-53-42
Оренбург (3532)37-68-04
Пенза (8412)22-31-16
Петрозаводск (8142)55-98-37
Псков (8112)59-10-37
Пермь (342)205-81-47

Ростов-на-Дону (863)308-18-15
Рязань (4912)46-61-64
Самара (846)206-03-16
Санкт-Петербург (812)309-46-40
Саратов (845)249-38-78
Севастополь (8692)22-31-93
Саранск (8342)22-96-24
Симферополь (3652)67-13-56
Смоленск (4812)29-41-54
Сочи (862)225-72-31
Ставрополь (8652)20-65-13
Сургут (3462)77-98-35
Сыктывкар (8212)25-95-17
Тамбов (4752)50-40-97
Тверь (4822)63-31-35

Тольятти (8482)63-91-07
Томск (3822)98-41-53
Тула (4872)33-79-87
Тюмень (3452)66-21-18
Ульяновск (8422)24-23-59
Улан-Удэ (3012)59-97-51
Уфа (347)229-48-12
Хабаровск (4212)92-98-04
Чебоксары (8352)28-53-07
Челябинск (351)202-03-61
Череповец (8202)49-02-64
Чита (3022)38-34-83
Якутск (4112)23-90-97
Ярославль (4852)69-52-93

Россия +7(495)268-04-70


Казахстан +(727)345-47-04

Беларусь +(375)257-127-884

Узбекистан +998(71)205-18-59

Киргизия +996(312)96-26-47

эл.почта: huj@nt-rt.ru || сайт: <https://heju.nt-rt.ru/>

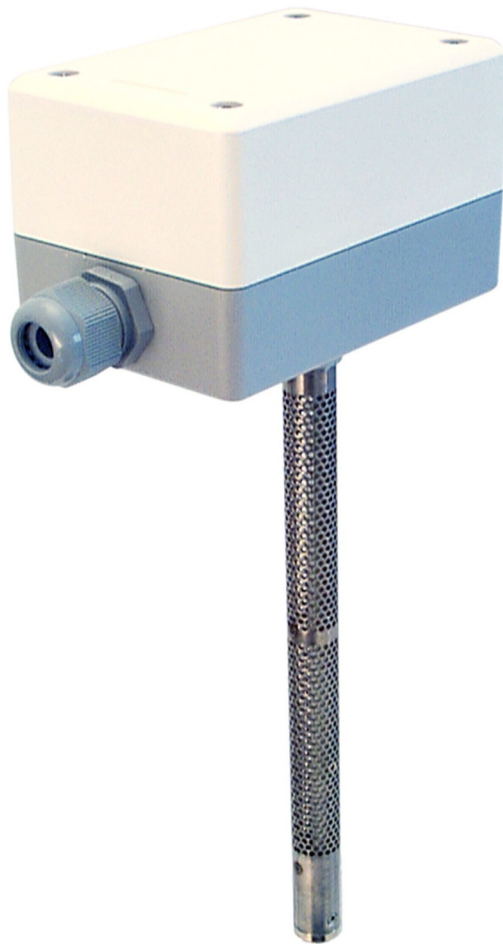

Humidity Temperature Sensor TFG80 Duct version with Polyga measuring element

- For semi-industrial and industrial use up to 80°C and 100 % rh.
- High accuracy in the high humidity range
- Long term stability
- Robust, resistant to high humidity, with washable measuring element
- Energy saving: the TFG80H with resistance output does not require its own power supply

POLYGA® transmitters demonstrate excellent measuring properties and accuracy in high humidity. They can be adjusted and cleaned in water. Their outstanding durability, reliability and robustness make them the classic choice for applications with extended high humidity.

The TFG80 temperature and humidity sensor in duct design is ideal for use in ventilation ducts and climatic chambers, industrial buildings and containers, and is suitable for indoor and outdoor applications.

Galltec offers the relevant accessories for the variety of applications.

Accessories

Order no.		Description
20.009		wall console of plastic, for mounting sensors Ø 20 mm with mounting sleeve 00.502 also suitable for sensor tubes Ø 15 mm
20.008		fixing flange for duct mounting of HG80 and FG80 <i>optional attachment for a quicker removal of the sensor</i>
20.024		canvas blind for outdoor applications, aluminium sheet, available with solar cell to supply the sensor
20.022		Ventilated sensor tube for improved air flow, 24V DC
23.063		PTFE filter, two-part, <i>recommended for extreme operating conditions</i>
20.011		protector tube for external mounting, for protection against rain and sun
20.014		protective tube made of gauze <i>recommended for air speeds between 8 and 15 m/s</i>

Type survey passive sensors

Type	Order no.	Measuring range		Conductor system	Outputs	
		Humidity	Temperature		Humidity	Temperature
FG80H	44010300	0 ... 100 % rh	-	2-pin	0 ... 1000 Ω linear	-
	44010400	0 ... 100 % rh	-	2-pin	100 ... 138,5 Ω lin.	-
	44010100	0 ... 100 % rh	-	2-pin	0 ... 100 Ω lin.	-
	44010200	0 ... 100 % rh	-	2-pin	0 ... 200 Ω linear	-
TFG80H	44700350	0 ... 100 % rh	Pt100	2-pin	0 ... 1000 Ω linear	Pt100
	44700450	0 ... 100 % rh	Pt100	2-pin	100 ... 138,5 Ω linear	Pt100
	44700150	0 ... 100 % rh	Pt100	2-pin	0 ... 100 Ω linear	Pt100
	44700250	0 ... 100 % rh	Pt100	2-pin	0 ... 200 Ω linear	Pt100
	44732666	0 ... 100 % rh	NTC	2-pin	0 ... 48 k Ω non-linear	NTC


Further resistance ranges on request.

Type survey active sensors

Type	Order no.	Measuring range		Outputs		Conductor system	Supply voltage
		Humidity	Temperature	Humidity	Temperature		
FG80J FG80AC	44014700	0 ... 100 % rh	-	0 ... 10 V DC	-	3/4-wire	15 ... 30 V DC/ 24 V AC ± 10 %
	44014800	0 ... 100 % rh	-	4 ... 20 mA	-	2-wire	15 ... 30 V DC
	44013000	0 ... 100 % rh	-	0 ... 20 mA	-	3/4-wire	15 ... 30 V DC
	44014200	0 ... 100 % rh	-	0 ... 20 mA	-	3/4-wire	24 V AC
TFG80J TFG80AC	44514747	0 ... 100 % rh	0 ... 40°C	0 ... 10 V DC	0 ... 10 V DC	3/4-wire	15 ... 30 V DC/ 24 V AC ± 10 %
	44574747	0 ... 100 % rh	-30 ... 60°C	0 ... 10 V DC	0 ... 10 V DC	3/4-wire	15 ... 30 V DC/ 24 V AC ± 10 %
	44544747	0 ... 100 % rh	0 ... 100°C	0 ... 10 V DC	0 ... 10 V DC	3/4-wire	15 ... 30 V DC/ 24 V AC ± 10 %
	44624747	0 ... 100 % rh	-10 ... 90°C	0 ... 10 V DC	0 ... 10 V DC	3/4-wire	15 ... 30 V DC/ 24 V AC ± 10 %
	44514848	0 ... 100 % rh	0 ... 40°C	4 ... 20 mA	4 ... 20 mA	2-wire	15 ... 30 V DC
	44574848	0 ... 100 % rh	-30 ... 60°C	4 ... 20 mA	4 ... 20 mA	2-wire	15 ... 30 V DC
	44544848	0 ... 100 % rh	0 ... 100°C	4 ... 20 mA	4 ... 20 mA	2-wire	15 ... 30 V DC
	44624848	0 ... 100 % rh	-10 ... 90°C	4 ... 20 mA	4 ... 20 mA	2-wire	15 ... 30 V DC
	44513030	0 ... 100 % rh	0 ... 40°C	0 ... 20 mA	0 ... 20 mA	3/4-wire	15 ... 30 V DC
	44573030	0 ... 100 % rh	-30 ... 60°C	0 ... 20 mA	0 ... 20 mA	3/4-wire	15 ... 30 V DC
	44543030	0 ... 100 % rh	0 ... 100°C	0 ... 20 mA	0 ... 20 mA	3/4-wire	15 ... 30 V DC
	44623030**	0 ... 100 % rh	-10 ... 90°C	0 ... 20 mA	0 ... 20 mA	3/4-wire	15 ... 30 V DC
	44514242	0 ... 100 % rh	0 ... 40°C	0 ... 20 mA	0 ... 20 mA	4-wire	24 V AC
	44574242	0 ... 100 % rh	-30 ... 60°C	0 ... 20 mA	0 ... 20 mA	4-wire	24 V AC
	44624242	0 ... 100 % rh	-10 ... 90°C	0 ... 20 mA	0 ... 20 mA	4-wire	24 V AC
	44544242	0 ... 100 % rh	0 ... 100°C	0 ... 20 mA	0 ... 20 mA	4-wire	24 V AC
FG80JPt100	44704750	0 ... 100 % rh	Pt100	0 ... 10 V DC	Pt100	3/4-wire	15 ... 30 V DC/ 24 V AC ± 10 %
	44703050	0 ... 100 % rh	Pt100	0 ... 20 mA	Pt100	3/4-wire	15 ... 30 V DC
	44704850	0 ... 100 % rh	Pt100	4 ... 20 mA	Pt100	2-wire	15 ... 30 V DC

**suitable for EDJ_MIC regulator

Dimensions diagram

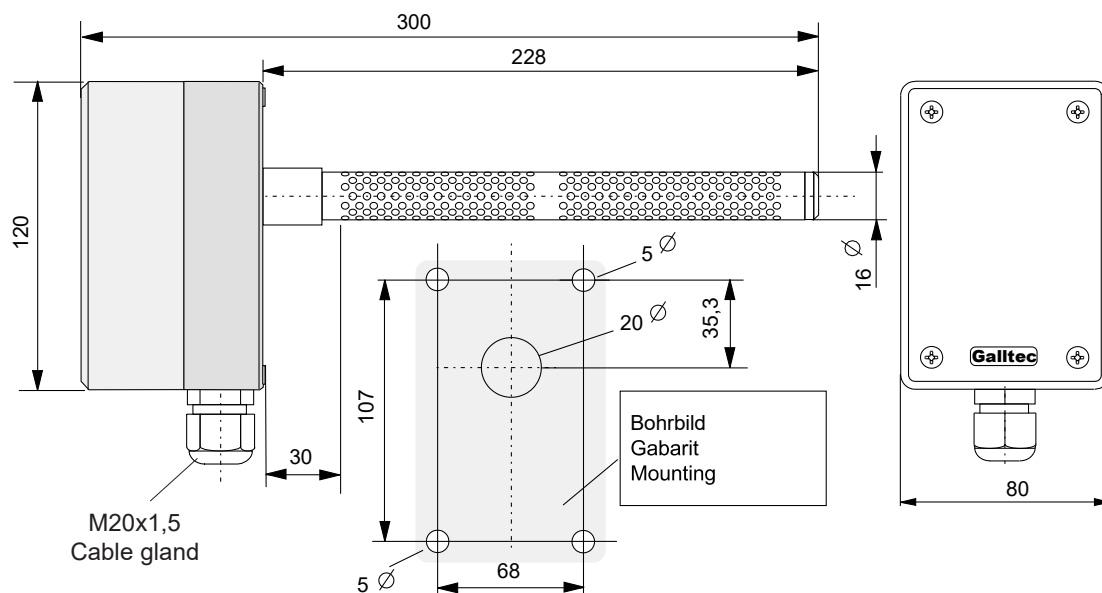

Technical Data

Humidity

Measuring range	0..100%rh
Measuring accuracy	>40%rh $\pm 2.5\%$ rh <40%rh acc. to tolerance diagram
Working range	30...100%rh
Medium temp. coefficient	-0.1%/K at 20°C and 50%rh
Half-life period at v=2m/sec	1.2min

Temperature

Measuring element	Pt100 ref. DIN EN 60751
Working range	-30...+80°C
Measuring accuracy	$\pm 0.5^\circ\text{C}$

Electrical data

Connecting terminals	for conductor cross sections 0.5mm ²
Cable connection	via twist nipple M20x1.5
Working range	30...100%rh

Directive about electromagnetic compatibility 2014/53/EU

DIN EN 61326-1	 issue 07/13
DIN EN 61326-2-3	 issue 07/13

Electrical data for passive sensors

Permissible load of signal outputs	
Humidity output	250 mW
Temperature output (Pt100)	1 mA at air speeds of 1 m/s


Electrical data for active sensors

Max. load for current output	500 Ohm
Min. load resistance for voltage output	10k Ohm
Consumption per measuring range	5 mA DC version
Consumption per measuring range	10 mA AC version
Linearity distortion of the temperature output	<0.5%


General data

Measuring medium	air, pressureless, non-aggressive
Adjustment	at average air pressure 430m NN
Permissible air speed	8m/sec
with protective gauze (order no. 20.014)	15m/sec
Permissible ambient temperature	
at the housing	-20...60°C
at the sensor	-40...+80°C
Fixing	slots in housing base for channel mounting console for wall mounting
Housing	ABS light grey
Sensor length;	220mm;
Sensor material	high-grade steel
Protective system	IP64
Weight	approx. 0.4 kg


Half-life period

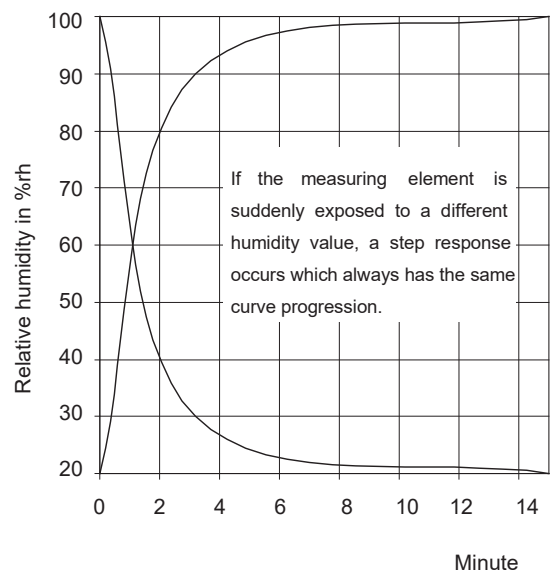

Humidity and tolerance diagram

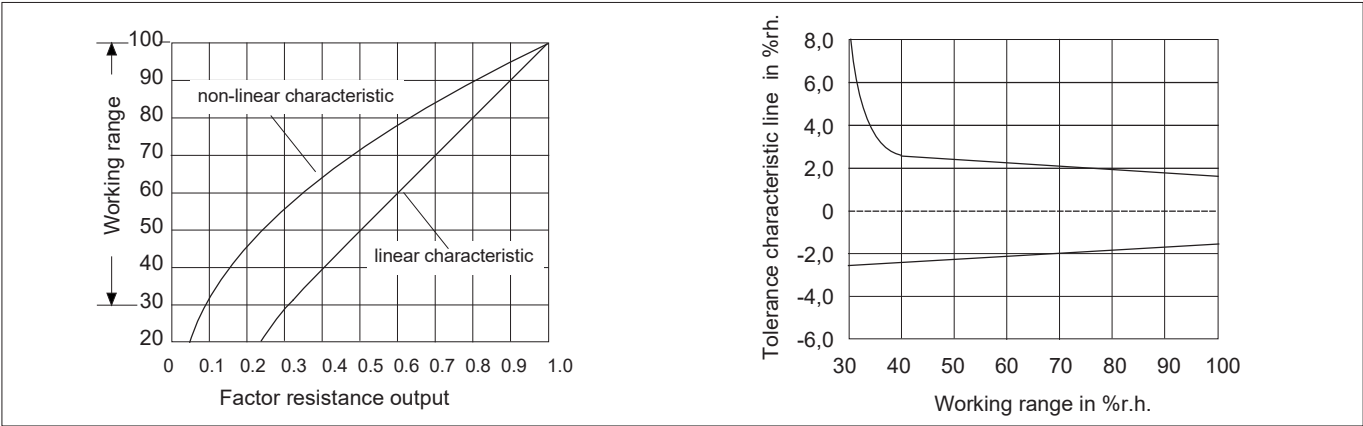


Thermalbehaviour

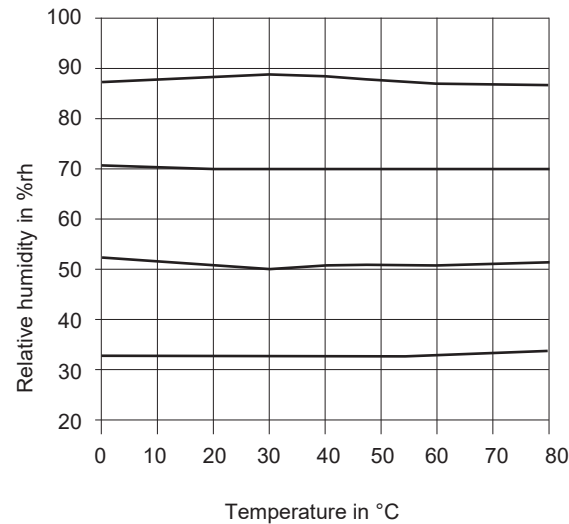


Connection diagram for passive sensors with resistance output



Connection diagram for active sensors with DC output

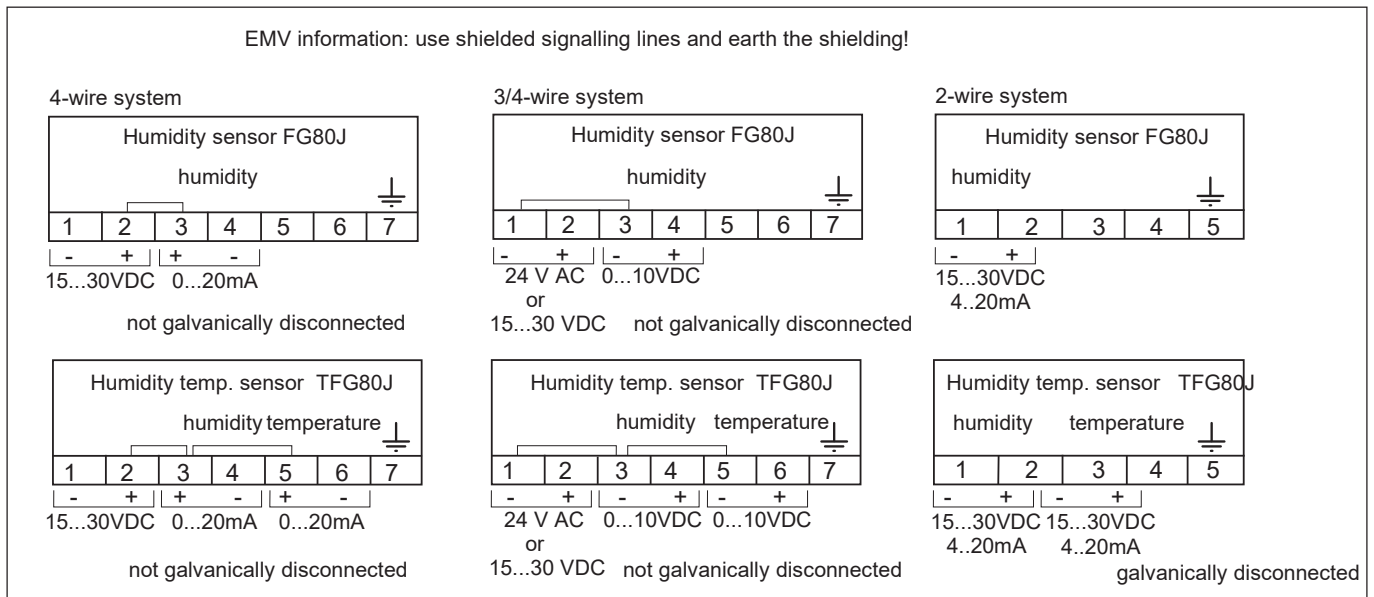

Connection diagram for active sensors with AC output (± 10 %)

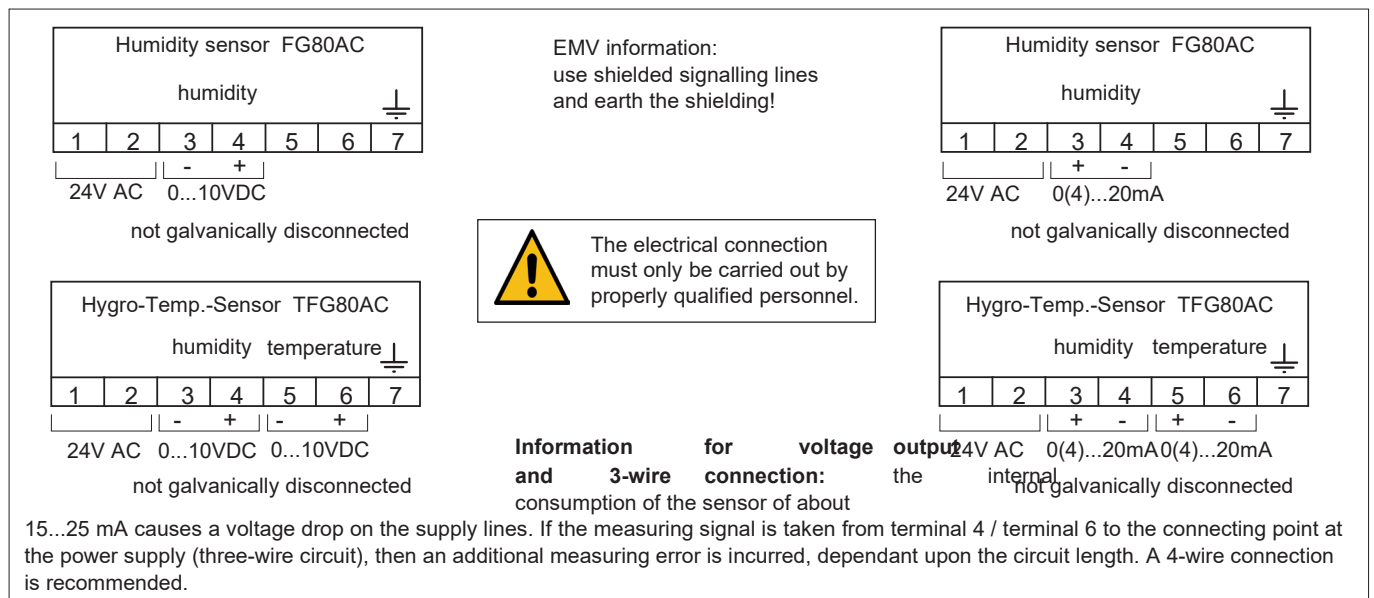

По вопросам продаж и поддержки обращайтесь:

Алматы (727)345-47-04
Ангарск (3955)60-70-56
Архангельск (8182)63-90-72
Астрахань (8512)99-46-04
Барнаул (3852)73-04-60
Белгород (4722)40-23-64
Благовещенск (4162)22-76-07
Брянск (4832)59-03-52
Владивосток (423)249-28-31
Владикавказ (8672)28-90-48
Владимир (4922)49-43-18
Волгоград (844)278-03-48
Вологда (8172)26-41-59
Воронеж (473)204-51-73
Екатеринбург (343)384-55-89

Иваново (4932)77-34-06
Ижевск (3412)26-03-58
Иркутск (395)279-98-46
Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Коломна (4966)23-41-49
Кострома (4942)77-07-48
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Курган (3522)50-90-47
Липецк (4742)52-20-81

Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Нижний Новгород (831)429-08-12
Новокузнецк (3843)20-46-81
Ноябрьск (3496)41-32-12
Новосибирск (383)227-86-73
Омск (3812)21-46-40
Орел (4862)44-53-42
Оренбург (3532)37-68-04
Пенза (8412)22-31-16
Петрозаводск (8142)55-98-37
Псков (8112)59-10-37
Пермь (342)205-81-47

Ростов-на-Дону (863)308-18-15
Рязань (4912)46-61-64
Самара (846)206-03-16
Санкт-Петербург (812)309-46-40
Саратов (845)249-38-78
Севастополь (8692)22-31-93
Саранск (8342)22-96-24
Симферополь (3652)67-13-56
Смоленск (4812)29-41-54
Сочи (862)225-72-31
Ставрополь (8652)20-65-13
Сургут (3462)77-98-35
Сыктывкар (8212)25-95-17
Тамбов (4752)50-40-97
Тверь (4822)63-31-35

Тольятти (8482)63-91-07
Томск (3822)98-41-53
Тула (4872)33-79-87
Тюмень (3452)66-21-18
Ульяновск (8422)24-23-59
Улан-Удэ (3012)59-97-51
Уфа (347)229-48-12
Хабаровск (4212)92-98-04
Чебоксары (8352)28-53-07
Челябинск (351)202-03-61
Череповец (8202)49-02-64
Чита (3022)38-34-83
Якутск (4112)23-90-97
Ярославль (4852)69-52-93

Россия +7(495)268-04-70

Казахстан +(727)345-47-04

Беларусь +(375)257-127-884

Узбекистан +998(71)205-18-59

Киргизия +996(312)96-26-47

эл.почта: huj@nt-rt.ru || сайт: <https://heju.nt-rt.ru/>